

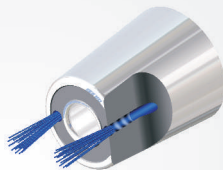


Shrink fit holder »Cool Tool« 4,5°

- Application:** Particularly suitable for tools without internal coolant, and for machining at difficult positions with bad chip removal.
- Technical Design:** Two holes in the toolholder lead the coolant directly to the cutting edge. Coolant holes can be re-sealed with screws for the use of tools with internal coolant holes.
- Includes:** Set screw and 2 x M3 screws to plug the coolant holes if needed.
- Accessories:** See page 134.

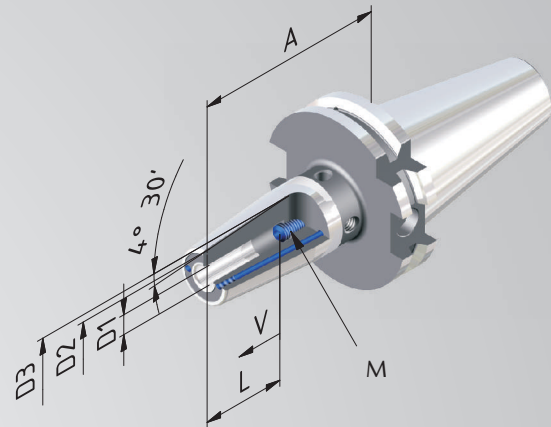

Fine balanced
G 2,5 at 25.000^{min} s
or max. residual imbalance
≤ 1 gmm

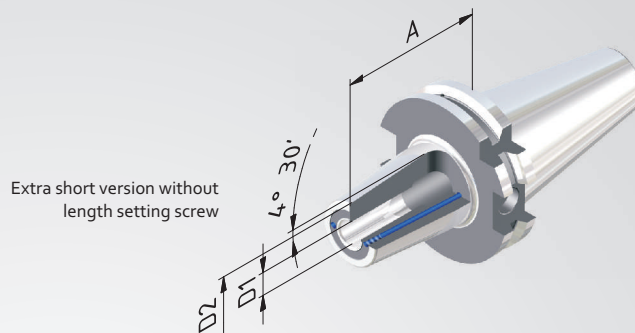

Order No.	SK	D1	A	D2	D3	V	L	M
EXTRASHORT								
7140219-03	40	10	65	26	-	-	42	-
7140219-04	40	12	65	26	-	-	48	-
7140219-06	40	16	65	29	-	-	51	-
7140219-08	40	20	65	35	-	-	53	-
7140219-09	40	25	75	45	-	-	59	-
SHORT								
714021-139*	40	3	80	26	-	-	42	-
714021-149*	40	4	80	26	-	-	48	-
714021-159*	40	5	80	29	-	-	51	-
714021-019	40	6	80	21	27	10	37	M5
714021-029	40	8	80	21	27	10	37	M6
714021-039	40	10	80	24	32	10	42	M8x1
714021-049	40	12	80	24	32	10	48	M10x1
714021-059	40	14	80	27	34	10	48	M10x1
714021-069	40	16	80	27	34	10	51	M12x1
714021-079	40	18	80	33	42	10	51	M12x1
714021-089	40	20	80	33	42	10	53	M16x1
714021-099	40	25	100	44	53	10	59	M16x1

* Cool tool holes can not be plugged.

Long versions see next page >>

Shrink fit holder »Cool Tool« 4,5°



Fine balanced
G 2,5 at 25.000^{min.}
or max. residual imbalance
≤ 1 gmm

Order No.	SK	D ₁	A	D ₂	D ₃	V	L	M
= 120								
714021-319	40	6	120	21	27	10	37	M5
714021-329	40	8	120	21	27	10	37	M6
714021-339	40	10	120	24	32	10	42	M8x1
714021-349	40	12	120	24	32	10	48	M10x1
714021-359	40	14	120	27	34	10	48	M10x1
714021-369	40	16	120	27	34	10	51	M12x1
714021-379	40	18	120	33	42	10	51	M12x1
714021-389	40	20	120	33	42	10	53	M16x1
= 130								
714021-5139*	40	3	130	12	17	-	-	-
714021-5149*	40	4	130	12	17	-	-	-
714021-5159*	40	5	130	12	17	-	-	-
714021-519	40	6	130	21	27	10	37	M5
714021-529	40	8	130	21	27	10	37	M6
714021-539	40	10	130	24	32	10	42	M8x1
714021-549	40	12	130	24	32	10	48	M10x1
714021-559	40	14	130	27	34	10	48	M10x1
714021-569	40	16	130	27	34	10	51	M12x1
714021-579	40	18	130	33	42	10	51	M12x1
714021-589	40	20	130	33	42	10	53	M16x1
714021-599	40	25	130	44	53	10	59	M16x1
714021-609	40	32	130	44	53	10	63	M16x1

* Cool tool holes can not be plugged.